

CLINTON SERVICE GUIDE

MODEL 115VS-FOTA-KS FOR YAMATO FD-62

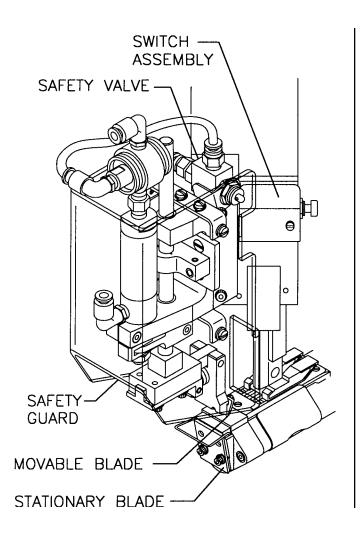

DRILLING INSTRUCTIONS CHAIN CUTTER MODEL 115VS FOTA

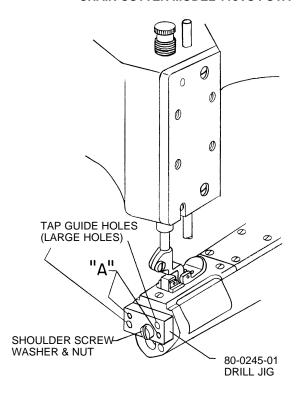


- 1. PLACE THE DRILL JIG ON THE MACHINE AS SHOWN.
- 2. ALIGN THE TOP OF THE DRILL JIG WITH THE TOP OF THE MACHINE BED.
- ${\tt 3.TIGHTEN}$ THE LOCKNUT ON END OF SHOULDER SCREW.
- 4. DRILL (2) TWO HOLES MARKED "A" WITH #29 DRILL (30-2130-29) SUPPLIED.
- LOOSEN THE LOCKNUT AND REALIGN THE JIG SO THE TAPPING GUIDE HOLES WILL ALIGN WITH THE DRILLED HOLES.
- 6. TAP THE HOLES WITH AN 8-32 TAP (30-1266-01) USING THE TAP GUIDE HOLES TO GUIDE THE TAP STRAIGHT.
- 7. REMOVE THE DRILL JIG.



Clinton Industries, Inc.
700 Washington Ave.
Carlstadt, N.J. 07072
Phone: 201-935-4242
Fax: 201-935-3615
www.clintonind.com
E-mail: general@clintonind.com

INS-2390

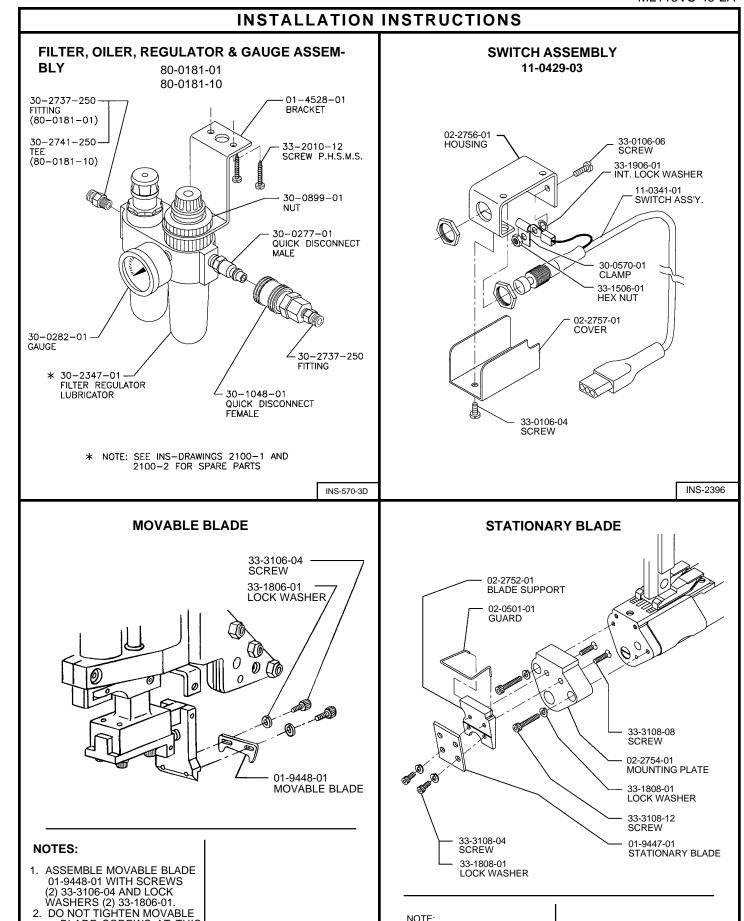

INS-2297

ASSEMBLE STATIONARY BLADE AS SHOWN


BLADE SCREWS AT THIS

REFER TO ALIGNMENT ADJUSTMENT.

INS-619-1A


ADJUSTMENTS

WARNING!! TO PREVENT SERIOUS INJURY, DISCONNECT AIR SUPPLY BEFORE MAKING ANY ADJUSTMENTS.

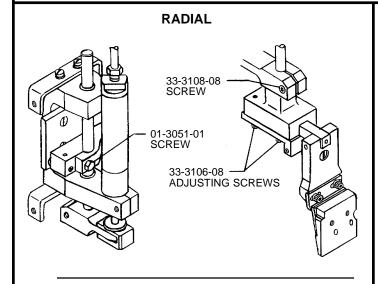


NOTES:


- LOOSEN SCREW 01-3051-01 AND 33-3108-08 AND ROTATE
- AND 33-3108-08 AND KOTATE
 ASSEMBLY FOR PROPER
 ENGAGEMENT.
 2. LOOSEN SCREWS 33-3106-08
 AND ADJUST MOVABLE BLADE
 AGAINST STATIONARY BLADE AND LOCK IN PLACE.

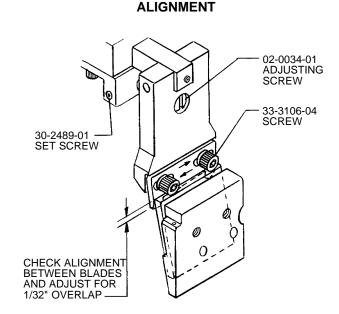


NOTE:

LOOSEN SET SCREW 30-2489-01 AND ADJUST SCREW 02-0034-01 COUNTER-CLOCKWISE FOR MORE CUTTING EDGE ENGAGEMENT.

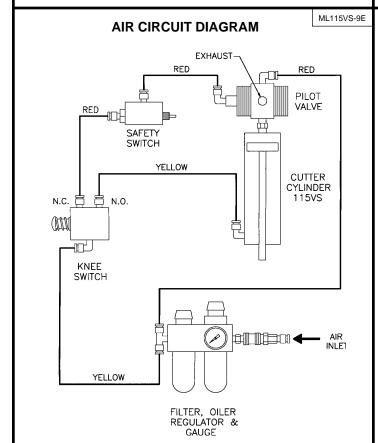

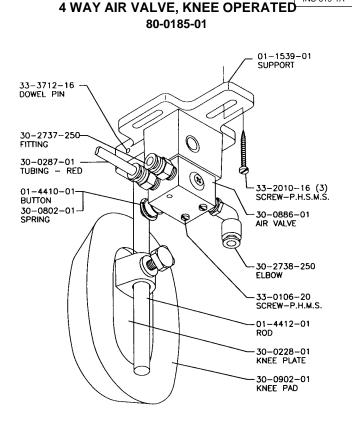

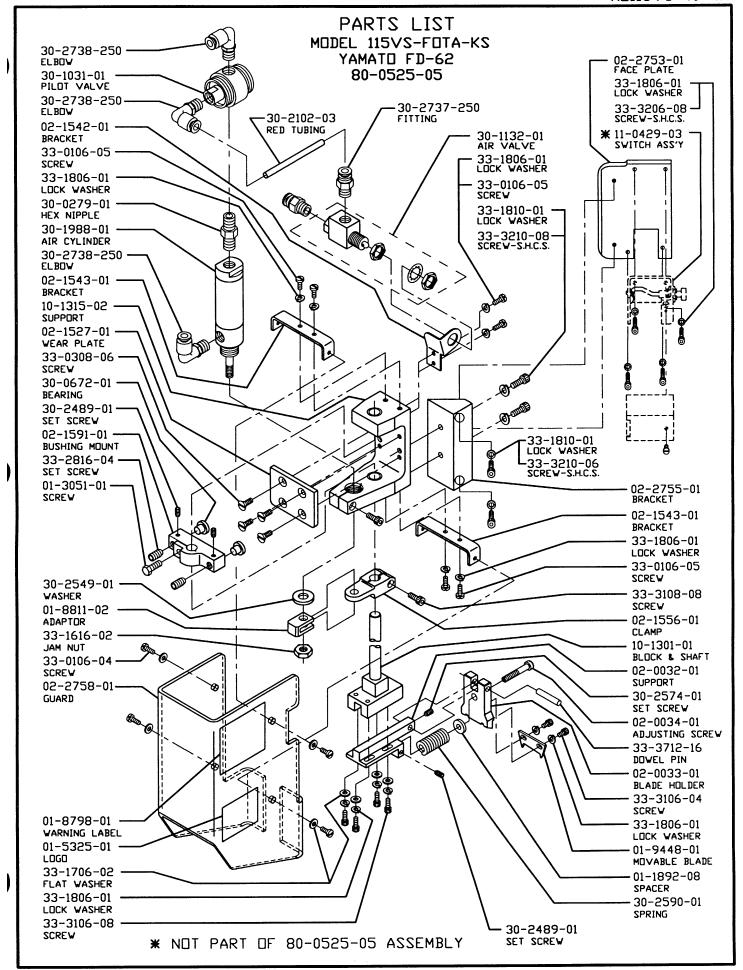

From the library of: Superior Sewing Machine & Supply LLC